PAGE: 1

PRINT DATE: 08/09/96

FAILURE MODES EFFECTS ANALYSIS (FMEA) - CIL HARDWARE

NUMBER: 05-6N-2015 -X

SUBSYSTEM NAME: EPD&C - AUXILIARY POWER UNIT (04-2)

REVISION: 1

08/30/93

PART DATA

PART NAME

VENDOR NAME

PART NUMBER

VENDOR NUMBER

LRU

: PANEL R2

V070-730277

SRU

: CIRCUIT BREAKER

MC454-0026-2030

EXTENDED DESCRIPTION OF PART UNDER ANALYSIS:

CIRCUIT BREAKER (3 AMP) - AUXILIARY POWER UNIT (APU) FUEL TANK 1, 2, AND 3 ISOLATION VALVE CONTROL

REFERENCE DESIGNATORS:

32V73A2CB1

32V73A2CB2

32V73A2CB3 32V73A2CB4 32V73A2CB5

32V73A2CB6

QUANTITY OF LIKE ITEMS: 6

SIX.

FUNCTION:

PROVIDES OVERLOAD PROTECTION IN THE CONTROL/LOGIC REDUNDANT CIRCUITS FOR THE APU FUEL TANK 1, 2, AND 3 ISOLATION VALVES.

PAGE 2

PRINT DATE: 08/19/96

FAILURE MODES EFFECTS ANALYSIS FMEA - NON-CIL FAILURE MODE

NUMBER: 05-6N-2015-02

REVISION#: 2

08/01/96

SUBSYSTEM NAME: EPD&C - AUXILIARY POWER UNIT (04-2)

1 000 770 0 1696

LRU: PANEL R2

CRITICALITY OF THIS

FAILURE MODE: 183

ITEM NAME: CIRCUIT BREAKER

FAILURE MODE:

FAILS CLOSED (FAILS TO OPEN - MECHANICALLY)

MISSIÓN PHASE:

OO ON-ORBIT

VERICLE/PAYLOAD/KIT EFFECTIVITY:

102 COLUMBIA

103 DISCOVERY

104 ATLANTIS

105 **ENDEAVOUR**

CAUSE:

STRUCTURAL FAILURE, CONTAMINATION, VIBRATION, MECHANICAL SHOCK. PROCESSING ANOMALY

. CRITICALITY 1/1 DURING INTACT ABORT ONLY? NO

REDUNDANCY SCREEN

A) PASS

B) N/A

C) PASS

PASS/FAIL RATIONALE:

ITEM IS STANDBY REDUNDANT.

C)

- FAILURE EFFECTS •

(A) SUBSYSTEM:

NO EFFÉCT, - EIRST FAILUHE. CIRCUIT BREAKER IS NORMALLY CLOSED.

(B) INTERFACING SUBSYSTEM(S): NO EFFECT - FIRST FAILURE

PAGE: 3 PRINT DATE: 08/12/96

| FAILURE MODES EFFECTS ANALYSIS (FMEA) - NON-CIL FAILURE MODE NUMBER: 05-6N-2015- 02

NO EFFECT - FIRST FAILURE

(C) MISSION:

NO EFFECT - FIRST FAILURE

(D) CREW, VEHICLE, AND ELEMENT(S):

NO EFFECT - FIRST FAILURE

(E) FUNCTIONAL CRITICALITY EFFECTS:

PÓSSIBLE LOSS OF CREW AND VEHICLE FOR FUEL LEAK DOWNSTREAM OF ISOLATION VALVE COMBINED WITH THIS FAILURE AND THREE OTHER FAILURES (ONE CONTACT SET OF APU FUEL ISOLATION SWITCH FAILED CLOSED, DIODE SHORTS, HDC- 3 FAILS "ON") DUE TO CONTINUOUS ENERGIZING OF THE ISOLATION VALVE WHICH PREVENTS ISOLATION OF FUEL LEAK.

-DISPOSITION RATIONALE-

(A) DESIGN:

RÉFER TO APPENDIX D, ITEM NO. 1 - CIRCUIT BREAKER

(B) TEST:

REFER TO APPENDIX D, ITEM NO. 1 - CIRCUIT BREAKER

GROUND TURNAROUND TEST FUEL ISOLATION VALVE CIRCUIT CHECKS WITHOUT BUS DROPS PERFORMED EVERY OMDP.

(C) INSPECTION:

RÉFER TO APPENDIX D, ITEM NO. 1 - CIRCUIT BREAKER

(D) FAILURE HISTORY:

REFER TO APPENDIX D, ITEM NO. 1 - CIRCUIT BREAKER

(E) OPERATIONAL USE:

NONE

FAILURE MODES EFFECTS ANALYSIS (FMEA) - NON-CIL FAILURE MODE NUMBER: 05-6N-2015- 02

- APPROVALS -

EDITORIALLY APPROVED EDITORIALLY APPROVED

TECHNICAL APPROVAL

: Ri

:JSC : VIA JSC